



St. George Transmission & Automotive

1349 W Sunset Blvd
St. George, UT 84770
(435) 628-1669
servicesgtrans@gmail.com

Invoice #75231

Page 1 of 7

09-29-20

Toquerville City

2002 GMC Sierra 3500

Toquerville City

PO Box 27
Toquerville, UT 84774
Treasurer@toquerville.org
(435) 216-6465

2002 GMC Sierra 3500

1GDJK34G82F100172
Engine: 8.1L V8 L18 GAS FI
Plate: 516168EX
Odometer In: 138031
Odometer Out:

Advisor: Jesse Hammer

Technician: Chandler Orr

GRAND TOTAL: \$3,612.21

BALANCE DUE: \$3,612.21

SERVICES

1

SGT Basic Vehicle Diagnostic Service

SUBTOTAL: \$0.00

Found transmission leaking from pump housing, will need to remove transmission for inspection.
Converter cooler has debris, recommend new converter and inspection of transmission internals.

Labor: \$0.00

Parts: \$0.00

Fees: \$0.00

Sublet: \$0.00

Brake booster and master cylinder leaking. Engine oil pan leaking oil.

LABOR

Diagnostic service includes: Scan test, road test (if possible), rack & inspect as needed, assessment of customer complaint(s), brief overview assessment of vehicle, and documentation of findings

2

Transmission Reseal/ Repair

SUBTOTAL: \$3,587.21

Removed and repaired transmission leak and burned clutch set. Replaced rear main seal and transmission mount. Replaced oil soaked range sensor harness and switch.

Labor: \$1,936.00

Parts: \$1,651.21

Fees: \$0.00

Sublet: \$0.00

LABOR

Remove & Replace Transmission Assembly
Flush and Flow Test Transmission Cooler & Lines
Bench Labor Repair Transmission
Renew Rear Main Seal

PARTS	PART #	QTY	EACH	TOTAL
C2 Power Pack	A116100APPK	1.0	\$257.78	\$257.78
Filter, 1000/2000 Allison 2WD and 4X4 Shallow Pan	A116010A-W	1.0	\$16.65	\$16.65
Filter, 1000 Series Allison	116013A-W	1.0	\$20.45	\$20.45
Valve Set, 1000/2000 Allison Shift Valves (Contains; Steel C, D, and E Valves)	A116741S-1K	1.0	\$94.84	\$94.84
Seal, 1000/2000 Allison Front (Pump)	116070A	1.0	\$10.98	\$10.98
Pump O-Ring	116311A-W	1.0	\$3.08	\$3.08
Torque Converter 8.1 Allison	4642-210-HDCO	1.0	\$490.91	\$490.91
Rear Main Seal Set	BS40673	1.0	\$64.91	\$64.91
Transmission Mount	B5340	1.0	\$58.24	\$58.24
Range Switch Connector (4 pin)	88987185	1.0	\$69.64	\$69.64
Range Switch Connector (7 pin)	15305887	1.0	\$148.14	\$148.14
Range Switch	29540479	1.0	\$249.33	\$249.33
Atf Multi Vehicle	ATF Multi	17.0	\$9.78	\$166.26



St. George Transmission & Automotive

1349 W Sunset Blvd
St. George, UT 84770
(435) 628-1669
servicesgtrans@gmail.com

Invoice #75231

Page 2 of 7
09-29-20
Toquerville City
2002 GMC Sierra 3500

Terms of Service:

1. "YES, DO THIS WORK"

I hereby authorize the corresponding service to be done along with the necessary materials.

2. "YOU MAY DRIVE MY CAR ON PUBLIC ROADS"

St. George Transmission & Automotive staff may operate my vehicle for the purpose of testing, inspection, and delivery.

3. "NO PAYMENT, NO KEYS"

An express lien is acknowledged on my vehicle to secure the amount of services thereto. Personal checks are generally not accepted.

4. "DIGITAL COMMUNICATION OK"

I welcome email and text from St. George Transmission & Automotive as a means of receiving copies and conveying authorization of my estimate, work order, invoice, and other relevant material concerning the repair of my vehicle. This is not an "Opt-In" for text marketing purposes.

5. "I UNDERSTAND THAT I AM RESPONSIBLE FOR THE SECURITY OF MY VEHICLE, AND ITS CONTENTS"

We make all possible efforts to keep your vehicle secure, but cannot make guarantees against forces beyond our control. This includes damage to vehicles while in the parking lot.

6. "WARRANTIES"

No worries, you are probably covered one way or another! Unless otherwise stated, General Repairs are covered by a 3 Year 36K Mile Nationwide Warranty. Automatic Transmission Overhaul repairs are covered for 3 Years, 100,000 miles nationwide through ATRA. Other repairs may have different warranty conditions, ask your service adviser for more details. Warranty repairs performed at a different shop can not exceed the the amount charged for the original repair.

*****. "HERE'S MY SIGNATURE"

I endorse the attached digital image of my signature as equivalent to my written signature and as proof of my agreement to these terms.

GRAND TOTAL: \$3,612.21

Total Labor: \$1,936.00

Total Parts: \$1,651.21

Total Fees: \$0.00

Total Sublets: \$0.00

Shop Supplies: \$25.00

Sales Tax: \$0.00

BALANCE DUE: \$3,612.21

Authorization:

7:29am 09/21/20



St. George Transmission & Automotive

1349 W Sunset Blvd
St. George, UT 84770
(435) 628-1669
servicesgtrans@gmail.com

Invoice #75231

Page 3 of 7
09-29-20
Toquerville City
2002 GMC Sierra 3500

NOTES

Keys left in dropbox with no info, need to find out what we are checking out

Written by Jesse Hammer | St. George Transmission & Automotive at 7:28AM 09/21/20

Check for transmission leaks

Written by Ryan Snow | St. George Transmission & Automotive at 1:42PM 09/21/20

Hydro boost/master cylinder is leaking



webcam-image.png

Written by Chandler Orr | St. George Transmission & Automotive at 3:34PM 09/21/20

Transmission is leaking.



webcam-image.png



webcam-image.png



webcam-image.png

Written by Chandler Orr | St. George Transmission & Automotive at 3:37PM 09/21/20

eingine oil pan is leaking



webcam-image.png



webcam-image.png

Written by Chandler Orr | St. George Transmission & Automotive at 3:38PM 09/21/20

Transmission leak is coming from gasket where transmission mates with bell housing

Written by Chandler Orr | St. George Transmission & Automotive at 4:18PM 09/21/20

Brake Booster & Master Cylinder \$875.94 +tax

Transmission Reseal \$1694.48 +tax

Approved in person, 9:59am 9/22/20



St. George Transmission & Automotive

1349 W Sunset Blvd
St. George, UT 84770
(435) 628-1669
servicesgtrans@gmail.com

Invoice #75231

Page 4 of 7
09-29-20
Toquerville City
2002 GMC Sierra 3500

Written by Ryan Snow | St. George Transmission & Automotive at 9:49AM 09/22/20

Transmission mount is cracked and worn. Recommend replacing.
Rear main seal is leaking alittle bit

Written by Chandler Orr | St. George Transmission & Automotive at 10:33AM 09/23/20



webcam-image.png

Written by Chandler Orr | St. George Transmission & Automotive at 10:34AM 09/23/20



webcam-image.png

Written by Chandler Orr | St. George Transmission & Automotive at 10:34AM 09/23/20

Spoke w/ Ryker, repair est at 3700, overhaul at 5500

Written by Ryan Snow | St. George Transmission & Automotive at 4:46PM 09/23/20

Approved repair, will have their mechanic do the brake booster.

Written by Ryan Snow | St. George Transmission & Automotive at 4:51PM 09/23/20


RnR transmission
Replaced neutral safety switch
Replaced neutral safety switch plugs

Written by Chandler Orr | St. George Transmission & Automotive at 1:27PM 09/28/20

Replaced rear main seal.
Used 17 Qts atf

Written by Chandler Orr | St. George Transmission & Automotive at 4:53PM 09/28/20

Attached Images:

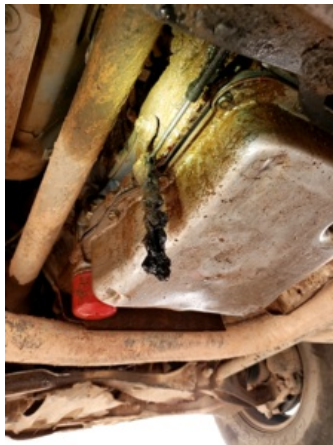





St. George Transmission & Automotive

1349 W Sunset Blvd
St. George, UT 84770
(435) 628-1669
servicesgtrans@gmail.com

Invoice #75231

Page 7 of 7
09-29-20
Toquerville City
2002 GMC Sierra 3500

